

Inspection Report (PSI)

REPORT NO.

VT-AMI-20180709-PSI-01A

P/I NO.

18LTJX1334

PRODUCT DESCRIPTION



Client Name: AMI (India) Private Limited

Product Name: Pressure Washer

Inspector: Mr.Jack chen

Report approver: Mr.Tommy Tu

Inspection type: PSI

Inspection location: Taizhou, Zhejiang, China

Inspection date: 09-Jul-2018

Your reference number: N/A

Item number: LT302-1400C

Buyers: AMI (India) Private Limited

Supplier: Lutian Machinery Co.,Ltd.

Order quantity: 1023 pcs

Pcs ready for inspection: 1023 pcs

Reference sample available: No

Departure time from home / office

09-Jul-2018 08:00

Arrival time at the factory

09-Jul-2018 08:30

Departure time from the factory

09-Jul-2018 16:30

Factory cooperation

AVERAGE

- Good - Enough manpower to assist, and good cooperation.
- AVERAGE - Enough manpower to assist.
- Poor - Manpower, equipment or document not provided timely.

Inspector's opinion on the factory

AVERAGE

- Good - The factory was neat and tidy. The testing equipment was well maintained and calibrated.
- AVERAGE - The factory was tidy, and the testing equipment ran normally.
- Poor - The factory was messed, the basic testing equipment was not available / not workable.

Report No. : VT-AMI-20180709-PSI-01A

Page 1 of 50

BEIJING VERITELL INSPECTION
TECHNOLOGY CO.,Ltd.

Rm. 303, Building 1#, XIANDAO DASHA,
Jinyuan Road 36#, Daxing District,
Beijing City, China.


Tel: +86-010-52879957
Fax: +86-010-89294617

Email: info@veritell.com
Website: www.veritell.com

INSPECTION STANDARDS

Inspection type	Pre-shipment Inspection
Sampling standard	ANSI/ASQ Z1.4-2008
Sampling level	Normal Single, Level II
AQL for Critical defective	0 (Not Allowed)
AQL for Major defective(2.5)	5
AQL for Minor defective(4.0)	7
Sampling size for Cri/Maj/Min	80pcs

INSPECTION RESULT SUMMARY

CATEGORY	Pending	Conform	Not Conform		
1.Quantity		√			
2.Packing & Shipping Marks		√			
3.Workmanship		√			
4.Dimension & Style & Weight		√			
5.Field Test		√			
6.Documentation		√			
AQL: (MIL-STD-105E)	Within AQL	AQL:	CRI	MAJ	MIN
N/A		Found	0	0	4
		Max	0	5	7
		Checked	80	80	80
OVERALL CONCLUSION:	 <p>Passed</p> <p>(Client has the final decision to Reject or Approve)</p>				

IMPORTANT REMARKS

Tiny defects were found, but within AQL.

QUALITY CRITERIA

1. Quantity

Expected Result	Result	Actual Finding / Comments
Products 100% finished and at least 80% packed	PASSED	Found 100% finished & packed
Quantity of producing products:	1023 pcs	
Quantity of finished & unpacked products:	Found 100% finished and packed	
Quantity of semi-finished products:	0	

N.O.	Item	Order Qty	Qty / Carton	Cartons	Quantity Breakdown			Sample Size	
					Packed	Unpacked	Unfinished	Packed	Unpacked
1	HIGH PRESSURE CLEANER LT302-1400C	773	1	773	773	0	0	70	0
2	Turbo lance	50	50	1	50	0	0	2	0
3	Quick connector QC01	50	50		50	0	0	2	0
4	FIX BRUSH B05	50	50	1	50	0	0	2	0
5	ROTARY BRUSH B06	50	20	2	50	0	0	2	0
			10	1					
6	B01 PRATIO BRUSH KIT	50	2	4	50	0	0	2	0
			12						
Total:		1023	/	782	1023	0	0	80	0

Selected Cartons :

__74__ Cartons were selected randomly on site.

Carton No.:

N/A

Remark:

N/A

2. Packing method & Shipping Marks

Expected Result	Result	Actual Finding / Comments					
Conform to client's spec	PASSED	Pls. see the following photos					
Packing	TOTAL NUMBERS OF PACKAGES: 782						
	(PACKING INFORMATION)						
	<table border="1"> <tr> <td>CASES: /</td> <td>ROLLS: /</td> <td>PALLETS: /</td> </tr> <tr> <td>BAGS: /</td> <td>CANS: /</td> <td>CARTONS: 782</td> </tr> </table>	CASES: /	ROLLS: /	PALLETS: /	BAGS: /	CANS: /	CARTONS: 782
CASES: /	ROLLS: /	PALLETS: /					
BAGS: /	CANS: /	CARTONS: 782					
Marking	* PACKING CONDITION :DRYING A main shipping mark on cartons						

Package Details

Item No.	Qty / Carton		Carton Size L×W×H (mm)		Gross Weight (KG)		Qty / Inner box	
	Marking	Actual	Marking	Actual	Marking	Actual	Marking	Actual
HIGH PRESSURE CLEANER LT302-1400C	/	1	340X265X413	335X268X413	6.9	6.689	/	/

Export Carton Details

Fastening Metal Staples	Yes	Nylon Band	No
Material	Cardboard	Corrugated Paper Plies	5ply

Packing Method

Pls See ref photos

Assortment Method

By style

Remark: N/A

MARKING & LABELING

Barcode/Labeling/Printing

Name	Location	Result
N/A	Pls see ref photos	Passed
Instruction manual and documentation check	Provided By	
N/A	Client	Passed
Shipping Marks		
Shipping Marks (on 2 side)		Passed
Side Marks (on 2 side)		Passed
Inner Box Marks (on / side)		/
Remark:	N/A	

3. Workmanship (appearance, coating, color, finish)

Expected Result	Result	Actual Finding / Comments
Conform to client's spec	PASSED	defect were found, and within AQL

Workmanship Defectives / Function Inspection Findings

Description		Critical	Major	Minor
HIGH PRESSURE CLEANER LT302-1400C Sample size: 70 pcs				
1.	Oil mark can be clean	0	0	1
2.	Impurity	0	0	1
3.	Poor assembly	0	0	2
Spare parts		Sample size: 10 pcs		

Report No. : VT-AMI-20180709-PSI-01A

Page 4 of 50

BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.

Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.

Tel: +86-010-52879957
Fax: +86-010-89294617

Email: info@veritell.com
Website: www.veritell.com

4.	No defect found	0	0	0
Total found:		0	0	4
Accepted:		0	5	7
Sample size:		80		
Remark:	N/A			
<p>Note: A <u>Defective</u> is defined as a unit of product that contains one or more defects. A <u>Defect</u> is defined as any non-conformance of the inspected unit of product with specified requirements. A single defect is taken into account per each defective unit; only one most serious defect is taken into account per each defective unit.</p>				

4. Dimensions & Style & Weight

Expected Result	Result	Actual Finding / Comments
Conform to client's spec	PASSED	Pls. see the attached DGT check records

	Client's Spec.	Ref. Sample	1# Sample	2# Sample	3# Sample
Item No.:	HIGH PRESSURE CLEANER LT302-1400C				
L×W×H (cm)	/	/	33X25.5X68	33X25.5X68	33X25.5X68
Gun size(cm)	/	/	84cm	84cm	84cm
Wire size(cm)	/	/	500	500	500
Pipe size(cm)	/	/	508	510	506
Net Weight (kg)	6.0kgs	/	5.753	5.788	5.756

5. Field Test

Expected Result	Result	Actual Finding / Comments
Conform to client's spec	PASSED	NO DEFECT WAS FOUND

	Description	Method	Sample Size	Result / Reading
1.	Barcode scan check	Reference factory SOP	S-2	Passed
2.	Assembly check			Passed
3.	Pull test			Passed
4.	Water Flow Rate Test			5.2L/min;5.32L/min
5.	Hydro Test			79.1Bar;75.1Bar
6.	Motor Power Test			1367W;1282W
7.	Hi-pot Test			Passed
8.	Functional Test			Passed
9.	3M tape Test			Passed
10.	Rub Test			Passed

Remark:	N/A
----------------	-----

6. Documentation

Expected Result	Result	Actual Finding / Comments
Conform to client's spec	PASSED	Pls. see the following table
Documents Used:	<input type="checkbox"/> L/C: <input checked="" type="checkbox"/> Catalogues:	<input checked="" type="checkbox"/> Proforma Invoice: <input type="checkbox"/> Draing(s): <input type="checkbox"/> Packing List: <input type="checkbox"/> Standard/Spec:
Attachment(s):	<p>More Description: As per drawings provided by Bartec.</p> <input checked="" type="checkbox"/> Certificate: <input type="checkbox"/> MD/SD: <input type="checkbox"/> Weight List: <input type="checkbox"/> Invoice(Proforma):	<input type="checkbox"/> Commercial Invoice: <input type="checkbox"/> Analysis Report: <input type="checkbox"/> Photo: <input type="checkbox"/> Health Certificate: <input checked="" type="checkbox"/> Test Report: <input checked="" type="checkbox"/> Packing List: <input type="checkbox"/> Attached Sheet: <input type="checkbox"/> Bag/pallet label:

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 6 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com

DEFECTIVE PHOTOS OF WORKMANSHIP



1. Oil mark can be clean-Min



2. Impurity-Min



3. Poor assembly-Min



4. Poor assembly-Min

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO.,LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 7 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO.,Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com

PHOTOS OF INSPECTION



5. Factory gate



6. Cargo stack



7. Cargo stack



8. Cargo stack

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 8 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



9. Master carton display



10. Main mark



11. Side mark



12. Side mark view



13. Side mark view



14. Main mark



15. Side mark



16. Side mark view



17. Side mark view

18. Barcode



19. Top mark



20. Bottom mark



21. Open the carton



22. 5-ply



23. Packing view



24. Polybag



25. Warning on the Polybag

26. Polybag view



27. Filter Nut

28. Filter Nut view

SAMPLE REPORT
 BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 12 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



29. Pipe



30. Pipe view



31. Pipe view



32. Polybag



33. Polybag view



34. Warning on the polybag



35. Airhole on the polybag

36. Polybag



37. Polybag view

38. Warranty card

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.


Report No. : VT-AMI-20180709-PSI-01A		Page 14 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com




39. Warranty card view





40. User's Manual

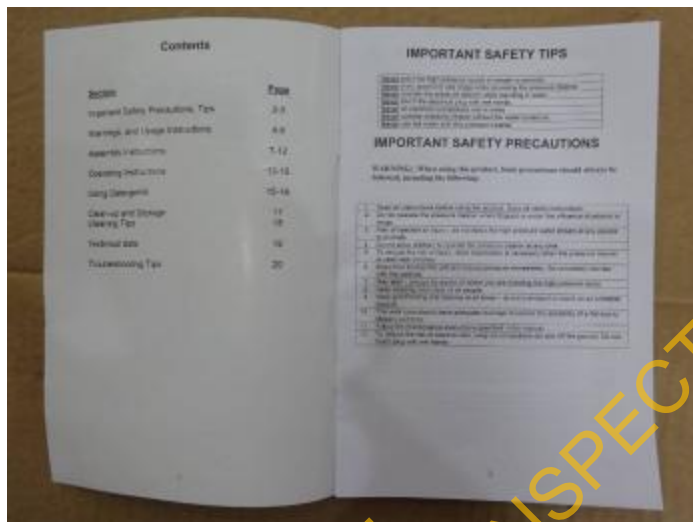


41. User's Manual view

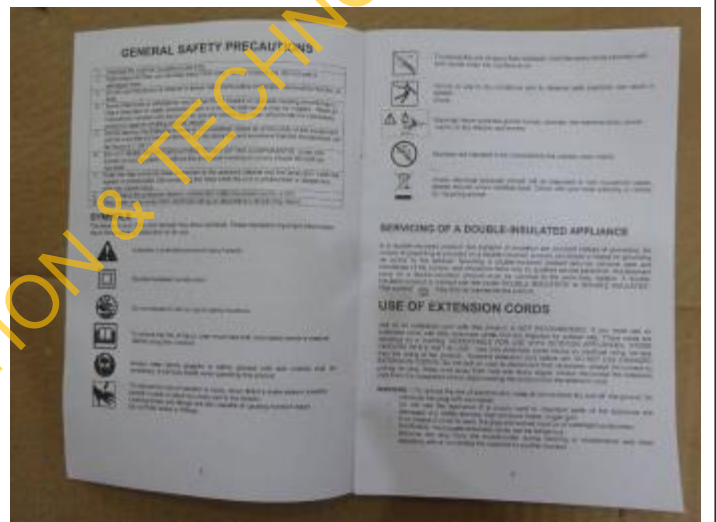


42. User's Manual view

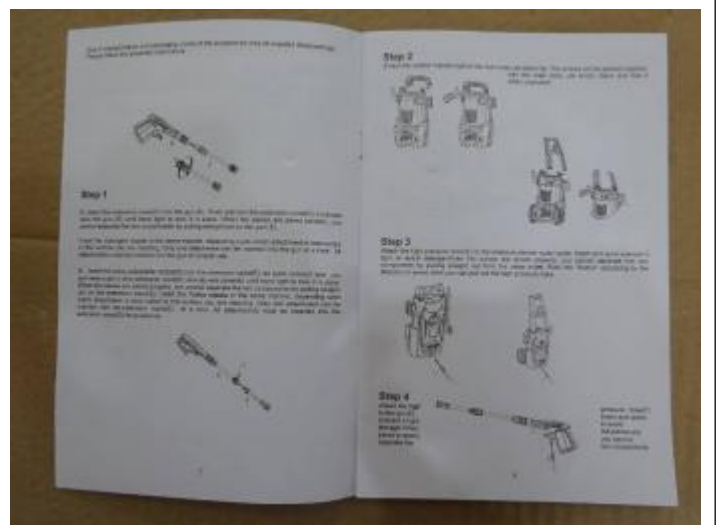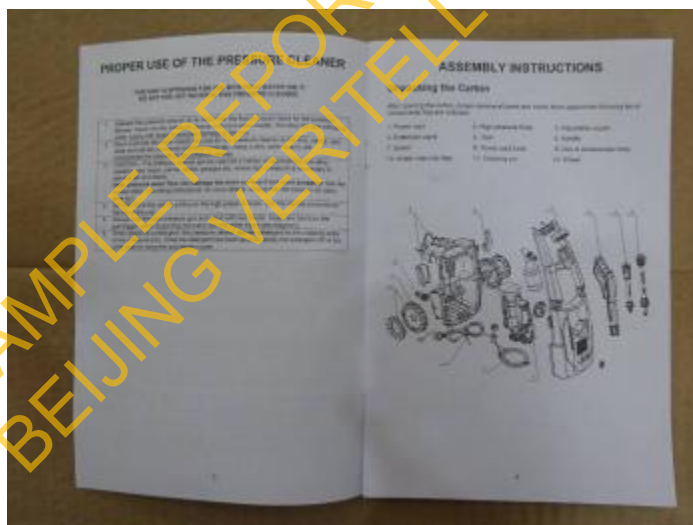


43. User's Manual view

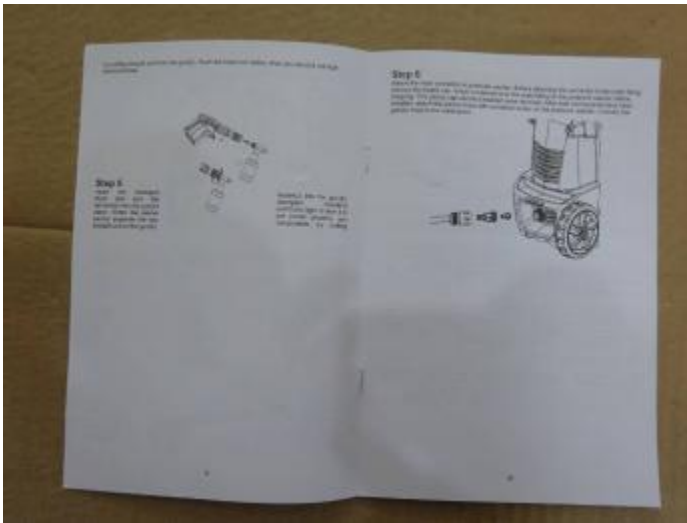


44. User's Manual view

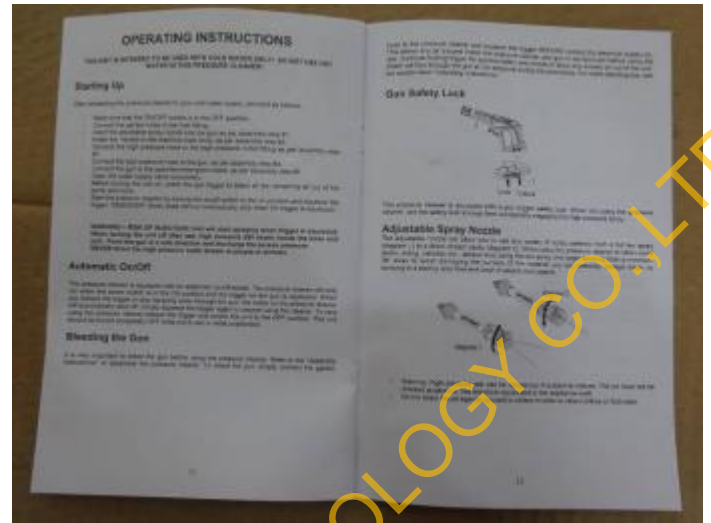

45. User's Manual view

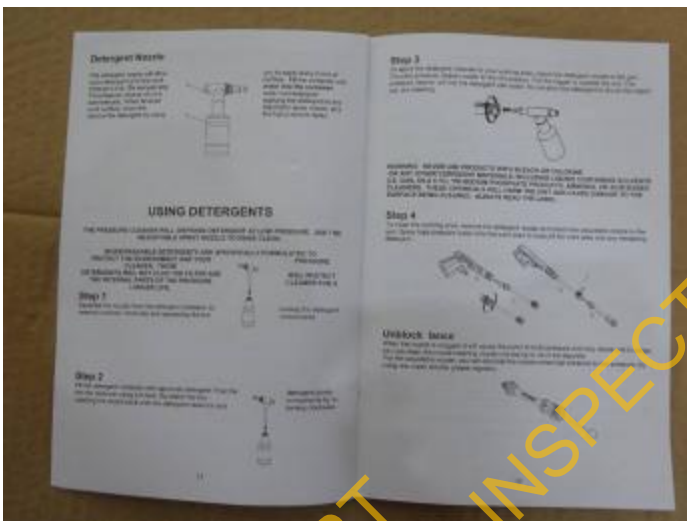


46. User's Manual view

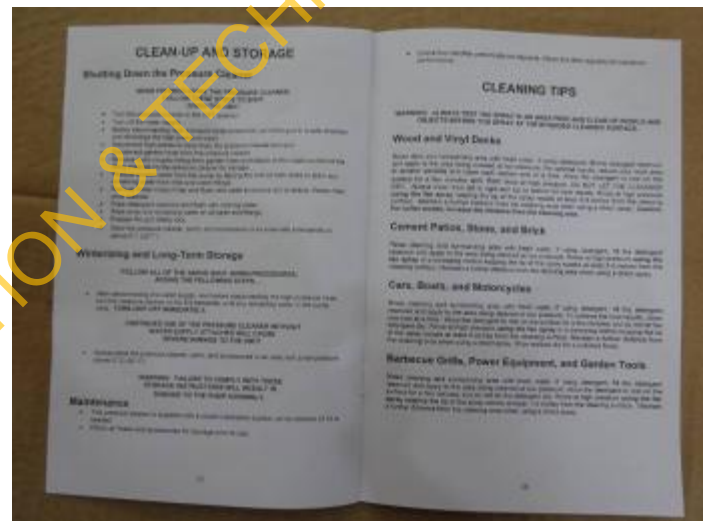


47. User's Manual view



48. User's Manual view



SAMPLE REPORT INSPECTION & TECHNOLOGY CO. LTD. BEIJING VERITELL INSPECTION & TECHNOLOGY CO. LTD.

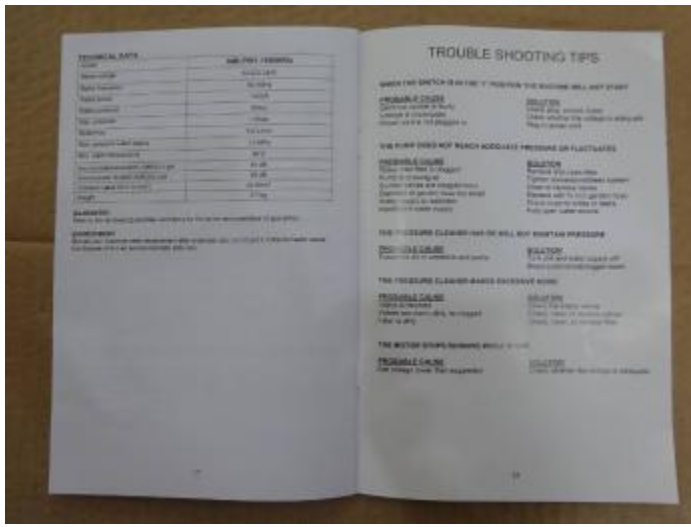

49. User's Manual view



50. User's Manual view



51. Screws bag



52. Screws



53. Product



54. Product view



55. Product view



56. Product view



57. Product logo

58. Product view

SAMPLE REPORT INSPECTION & TECHNOLOGY CO., LTD. BEIJING VERITELL



59. Product view



60. Product view



61. Product view



62. Product view



63. Product view



64. Product view



65. Product display



66. Nameplate



67. Label

68. Product view

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 20 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO.,Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



69. Product view



70. Product view



71. Wire



72. Wire mark



73. Plug



74. Plug view



75. Product view




76. Product view



77. Product view



78. Product view



SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 22 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



79. Gun



80. Gun view



81. Gun view



82. Gun view



83. Gun view



84. Gun view



85. Gun view




86. Gun view



87. Gun view



88. Gun view



SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 24 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



89. Gun view



90. Gun view



91. Gun view



92. Gun view



93. Gun view



94. Gun view

Nil

95. Gun view



96. Gross weight check




97. Gross weight:6.689kgs

SAMPLE REPORT INSPECTION & TECHNOLOGY CO., LTD.
BEIJING VERITELL



98. Carton size check(L)

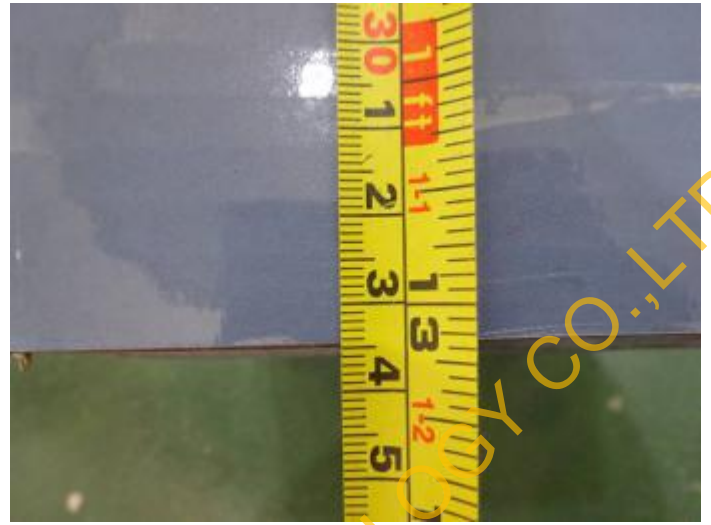

99. Carton size check(L): 35cm



100. Carton size check(W)



101. Carton size check(W): 26.8cm



102. Carton size check(H)



103. Carton size check(H): 41.3cm



104. Net weight check


105. Net weight check:5.753kgs



106. Product size check(L)

107. Product size check(L):33cm

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

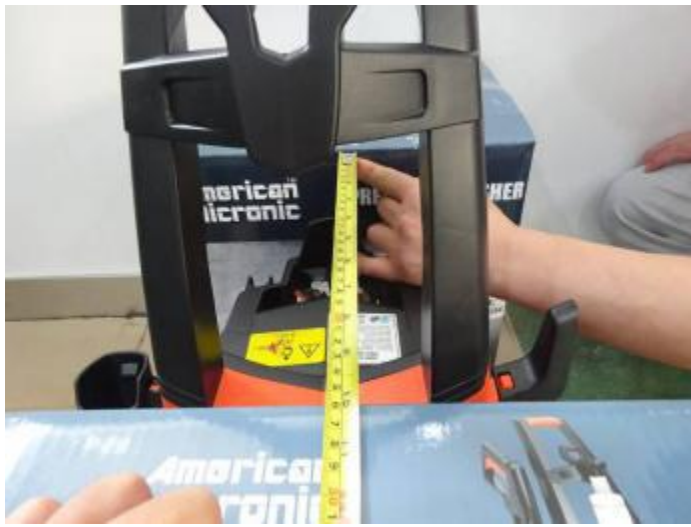

108. Product size check(W)



109. Product size check(W): 25.5cm



110. Product size check(H)



111. Product size check(H):68cm



112. Gun size check



113. Gun size check:84cm



114. Wire size check



115. Wire size check:500cm



116. Pipe size check



117. Pipe size check:508cm



Test

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO.,LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 30 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO.,Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



118. Barcode scan check




119. Assembly check



120. Assembly check



121. Pull Test

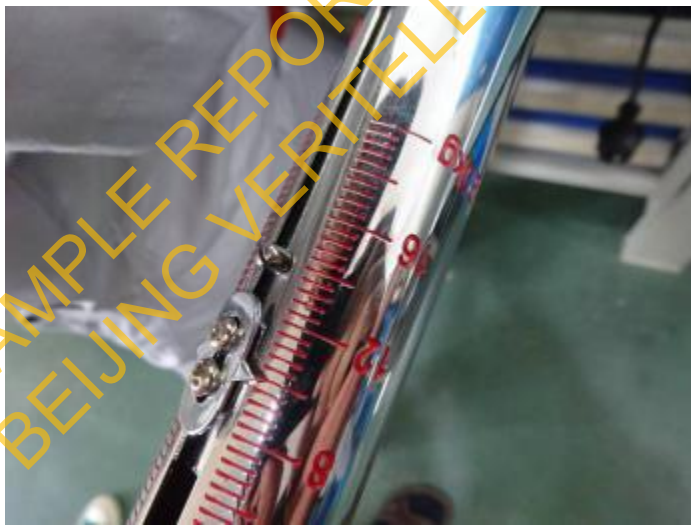

122. Pull Test



123. Pull Test



124. 3M tape Test



125. 3M tape Test




126. Rub Test


127. Rub Test

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 32 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com

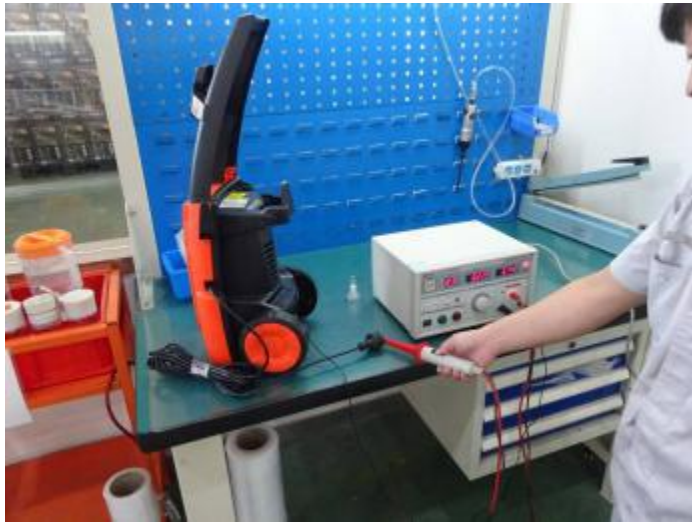

128. Hi-pot Test

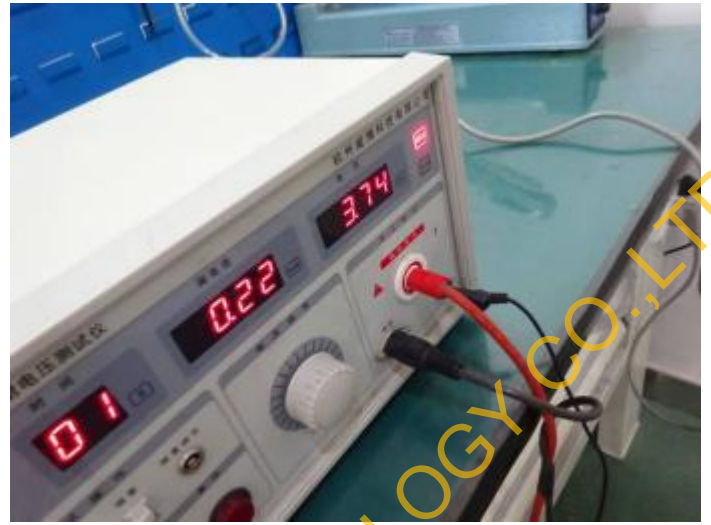

129. Hi-pot Test



130. Water Flow Rate Test&Hydro Test&Motor power test



131. Function test



132. Function test



133. Function test



134. Function test



135. Function test



136. Function test

137. Function test

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 34 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



138. Max water Flow Rate Test



139. Max water Flow Rate Test



140. Max water Flow Rate Test



141. Water Flow Rate Test&Hydro Test&Motor power test



142. Water Flow Rate Test&Hydro Test&Motor power test



143. Max water Flow Rate Test

Nil

144. Max water Flow Rate Test

Spare part



145. Cargo stack



146. Carton display

SAMPLE REPORT INSPECTION & TECHNOLOGY CO.,LTD.
BEIJING VERITELL INSPECTION & TECHNOLOGY CO.,LTD.



147. Open the carton



148. Open the carton



149. Polybag



150. Quick connector



151. Quick connector view



152. Quick connector view



153. Turbo lance



154. Turbo lance view



155. Turbo lance view

156. Carton display

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO.,LTD.



157. Open the carton



158. Ppatio brush kit



159. Ppatio brush kit view



160. Ppatio brush kit view



161. Ppatio brush kit view



162. Ppatio brush kit view



163. Ppatio brush kit view




164. Ppatio brush kit view



165. Ppatio brush kit view



166. Carton display



SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 40 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



167. Open the carton



168. Rotary brush view



169. Rotary brush view



170. Rotary brush view



171. Rotary brush view



172. Rotary brush view



173. Rotary brush view




174. Rotary brush view



175. Rotary brush view



176. Carton display



SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.



177. Open the carton



178. Fix brush




179. Fix brush view



180. Fix brush view



181. Fix brush view	182. Fix brush view
	<p>Nil</p>
183. Fix brush view	

Other

Packing list

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.


Report No. : VT-AMI-20180709-PSI-01A		Page 44 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com



Certificate

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.


Report No. : VT-AMI-20180709-PSI-01A		Page 45 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com

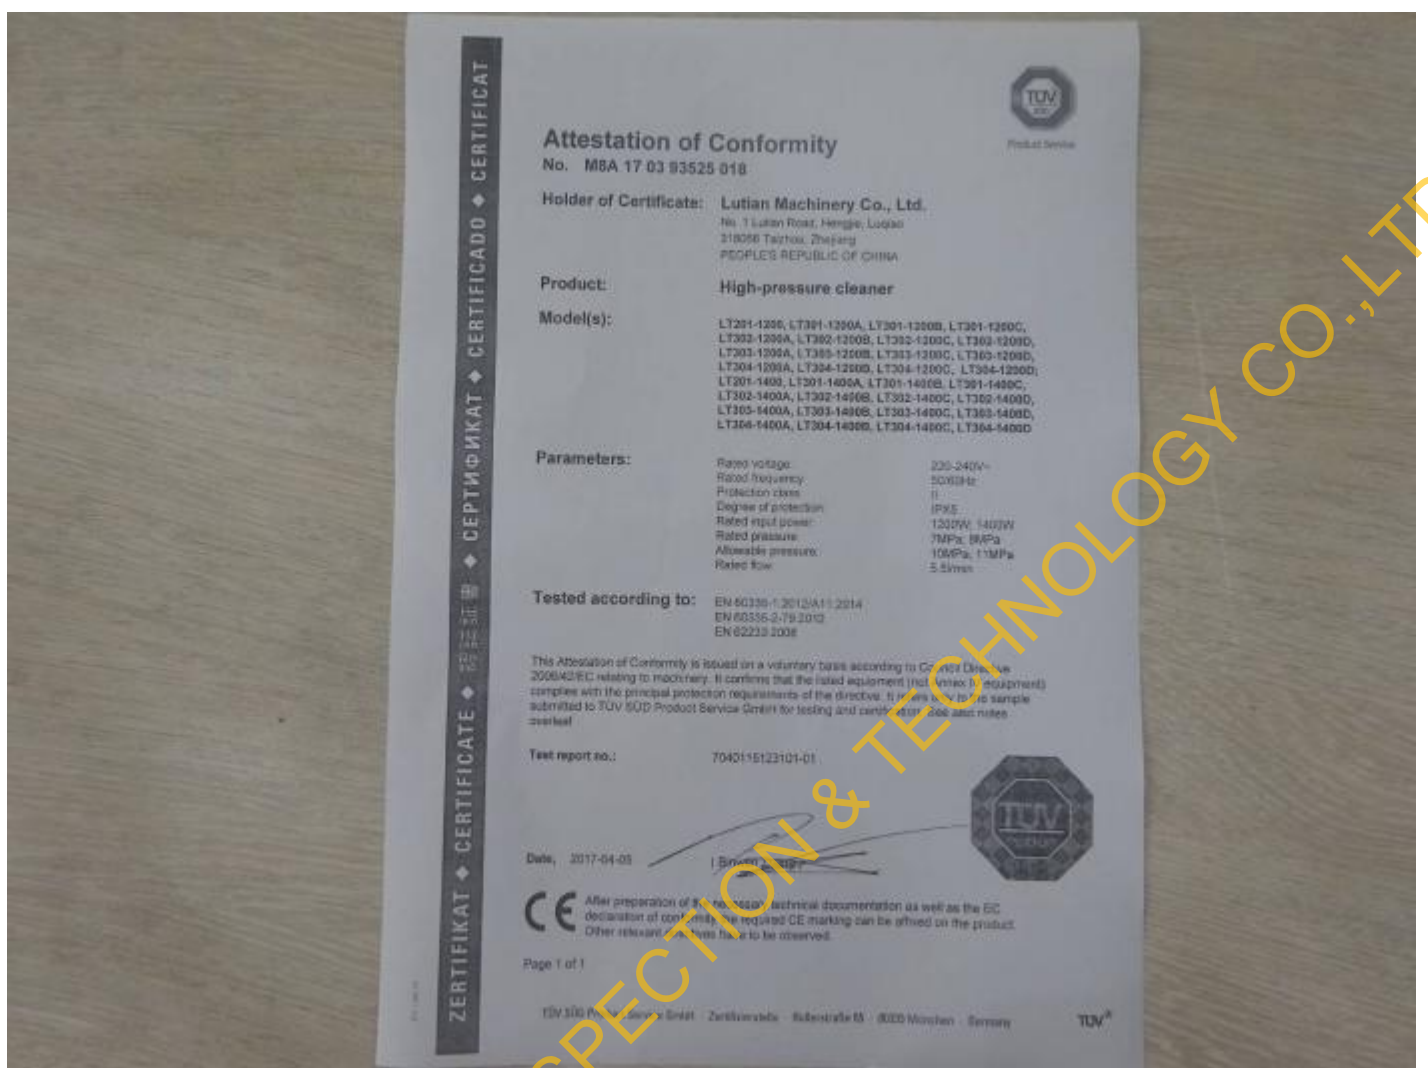

Test Report

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 46 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com

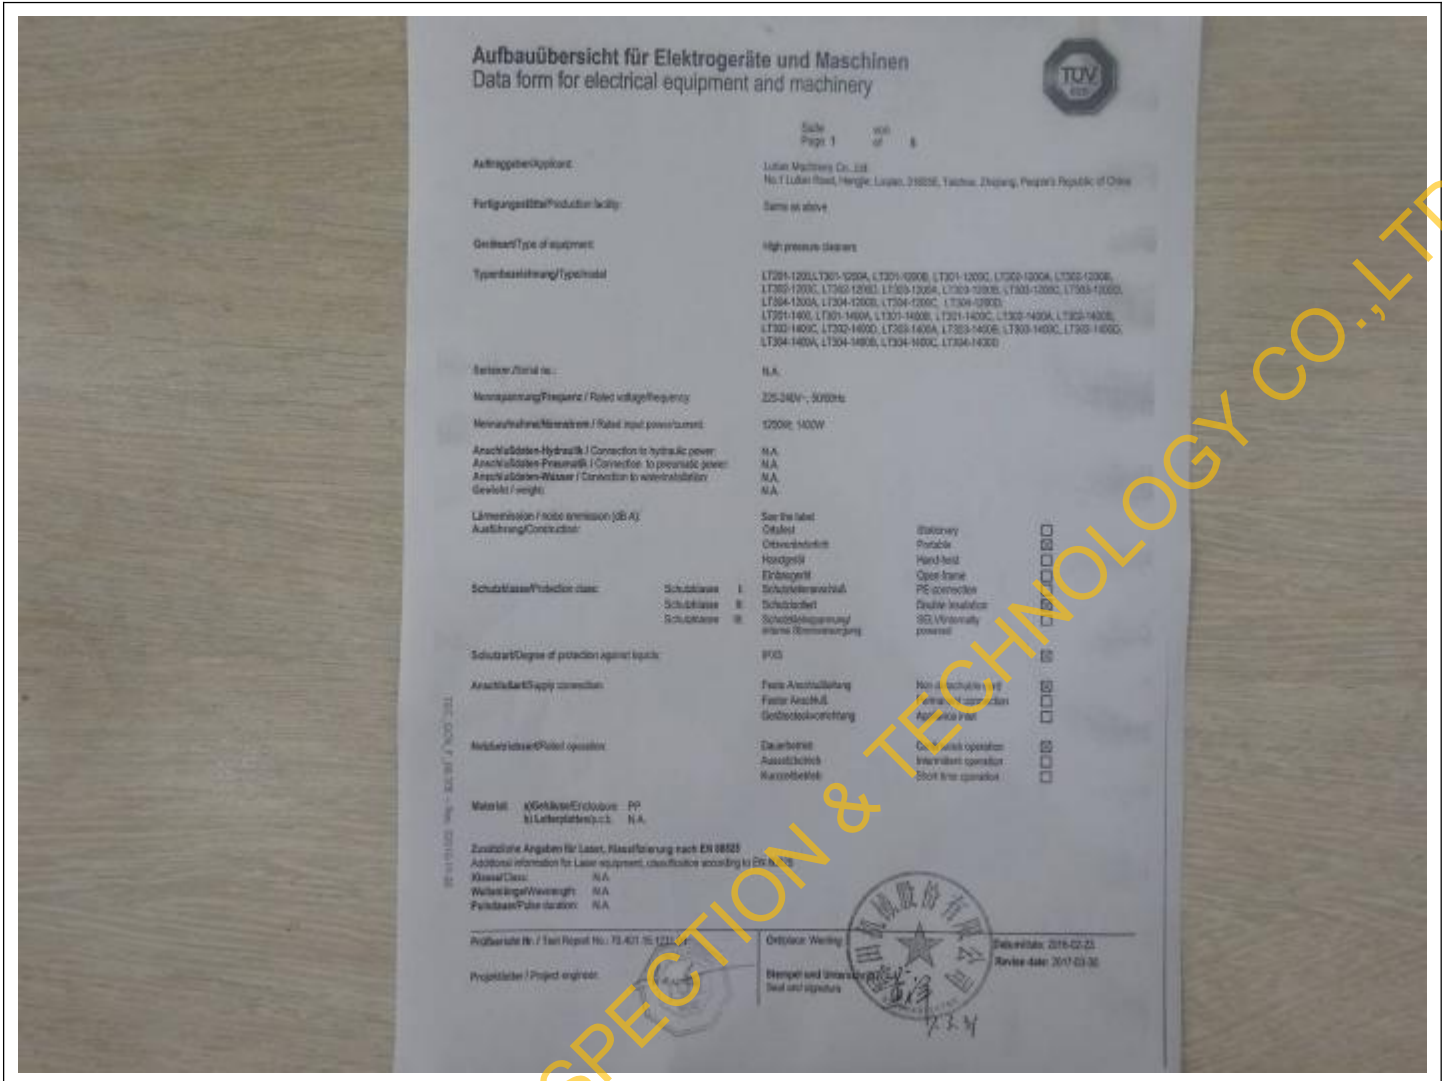


SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.

Report No. : VT-AMI-20180709-PSI-01A		Page 47 of 50
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617 Email: info@veritell.com Website: www.veritell.com



Inner test report

Report No. : VT-AMI-20180709-PSI-01A		Page 48 of 50	
BEIJING VERITELL INSPECTION TECHNOLOGY CO., Ltd.	Rm. 303, Building 1#, XIANDAO DASHA, Jinyuan Road 36#, Daxing District, Beijing City, China.	Tel: +86-010-52879957 Fax: +86-010-89294617	Email: info@veritell.com Website: www.veritell.com

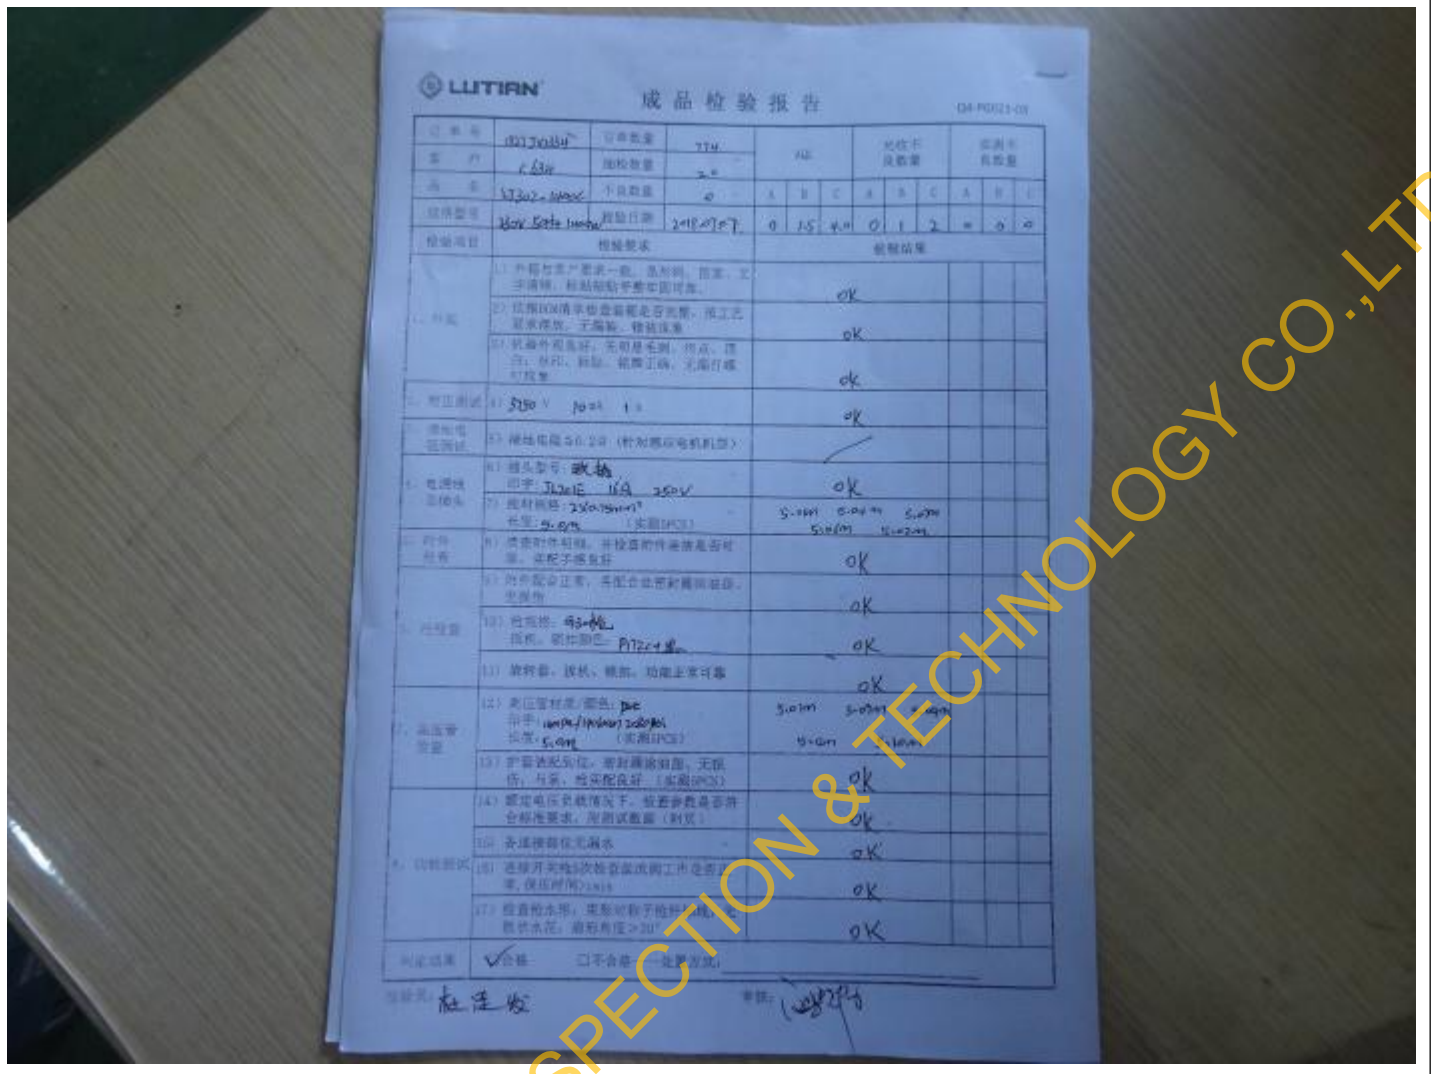

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.



序号	品名	数量	电压	电阻	电容	电感	频率	功率	温度	湿度	光照	噪音	振动	其他
1	pw18071000-173	3±1	230V	±6.2	1300	70-80	5-30±0.2	95-115	±30	>1				
2	1408	3-2	230.0	5.90	1297	75	5-28	104	22	✓				
3	1405	3-2	230.0	5.88	1303	75	5-33	109	21	✓				
4	1406	3-3	230.0	5.90	1297	73	5-31	104	22	✓				
5	1407	3-2	230.1	5.87	1298	74	5-30	107	21	✓				
6	1507	3-2	230.2	5.92	1292	74	5-27	110	22	✓				
7	1510	3-2	230.0	5.90	1294	73	5-32	104	21	✓				
8	1512	3-3	230.1	5.92	1294	75	5-28	107	22	✓				
9	1517	3-2	230.0	5.92	1305	75	5-30	106	21	✓				
10	1322	3-2	230.0	5.90	1298	75	5-26	103	21	✓				
11	1323	3-2	230.1	5.87	1302	75	5-32	110	22	✓				
12	1321	3-3	230.2	5.92	1299	74	5-27	110	22	✓				
13	1320	3-3	230.0	5.86	1302	74	5-30	109	21	✓				
14	1277	3-2	230.0	5.91	1277	73	5-27	105	21	✓				
15	1279	3-3	230.1	5.88	1306	74	5-29	107	21	✓				
16	1278	3-2	230.0	5.90	1302	74	5-28	104	22	✓				
17	1275	3-3	230.0	5.87	1295	74	5-30	105	21	✓				
18	1221	3-2	230.1	5.91	1302	73	5-27	102	21	✓				
19	1224	3-2	230.0	5.89	1300	74	5-27	100	22	✓				
20	1223	3-2	230.1	5.92	1301	75	5-27	99	22	✓				

Inspector: 杜建发

The inspection report reflects our findings at the time and place of inspection. This report does not relieve the seller/manufacturer of their contractual liabilities or prejudice from the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter

*******End of the Report*******

SAMPLE REPORT
BEIJING VERITELL INSPECTION & TECHNOLOGY CO., LTD.