

GENERAL INFORMATION



Product Name	Fabric –Woven
Model number	100% cotton
P/O number	HO/87046
Quantity	36,030mts
Client name	XXX Textiles Limited
Supplier name	Jiangsu Hendry Textile Printing& Dyeing CO.,Ltd
Inspection date	Aug 31 2017
Arrival time	9:00AM
Departure time	14:00PM
Inspection location	Yixing city, Jinagsu province,
Inspector	Mr.Tommy
Supervisor	Mr.Tom

INSPECTION RESULT SUMMARY

Item	Pass/Pending/Failed	Remark
Quantity check	Failed	Order number 36,030mts ,supplier provided 36121.7mts
Products finishing ,artwork	Pass	
Product color, printing	Pass	
Product size /Weight	Pass	
T E S Roll length test	Pass	
Static Electricity	Pass	

T	Fabric weight test	Pending	The supplier's fabric cutting machine is not keenness to cut the intact roundness QC randomly selected from the production of each color sample 11.3cm circle diameter. The fabric weight all has the difference. (GSM : 132g—141g)(Please see below).			
	Color fastness test	Pass				
	Smell check	Pass	No bad smell			
	Packing carton and marks	Pass	Roll with related shipping marks			
Inspection standard: MIL-STD-105E, Fixed, AQL 2.5/4.0						
	Defectives list	Sample size : 703.8m(6roll)		CRITICAL	MAJOR	MINOR
			AQL	0	2.5	4.0
			AC/RE	0	0	0
			Defect found	N/A	N/A	N/A
	About factory	Available	Pls see the related pictures			

OVERALL CONCLUSION

	Pending	
--	---------	--

Comments:

- 1: Aug 31, 2017, inspector visited suppliers of goods inspection, we have the following comments:
- 2: The order quantity was 36,030mts, supplier provided 36121.7mts, all finished production has been completed in the warehouse, total 289 rolls
- 3: No scale provided from supplier to do 1 roll weight check
- 4: QC randomly selected from the production of each color sample 11.3cm circle diameter.
The fabric weight all has the difference. (GSM : 132-141g)(Please see figure below to confirm)
- 5: Compare to the client approved swatch, the color shade of checked samples were not obviously difference.
- 6: The quality of each product please below to view the corresponding conclusion!
- 7: In the discussion on the basis of our final examination result determination: **Pending**

A. Quantity / 数量

Model Number	Ordered Qty	Available Qty	Packed rolls	Final Shipped Qty	Inspection Sample Qty
--------------	-------------	---------------	--------------	-------------------	-----------------------

	36,030	36,121.7	36,121.7	36,121.7	703.8m/6roll
TOTAL:	36,030	36,121.7	36,121.7	36,121.7	703.8m/6roll

Comments:

1 : The order quantity was 36,030mts ,supplier provided 36121.7mts all finished production has been completed in the warehouse ,total 289 rolls

A-1. Products Measurement and weight check

Item	Product Size	Carton Size(cm)	G.W.(kgs)	N.W.(kg)
	N/A	N/A	N/A	N/A

Comments:

A-2. Products Weight check list

	318#	64#	276#	150#	146#	212#
	136-137	132-137	136-139	133-141	131-132	135-136

Comments:

1. No GSM data from order ,pls check below pictures

Quantity check



All products in the warehouse




All products in the warehouse

Products finishing ,artwork and product colour,printing

318# roll



Package view

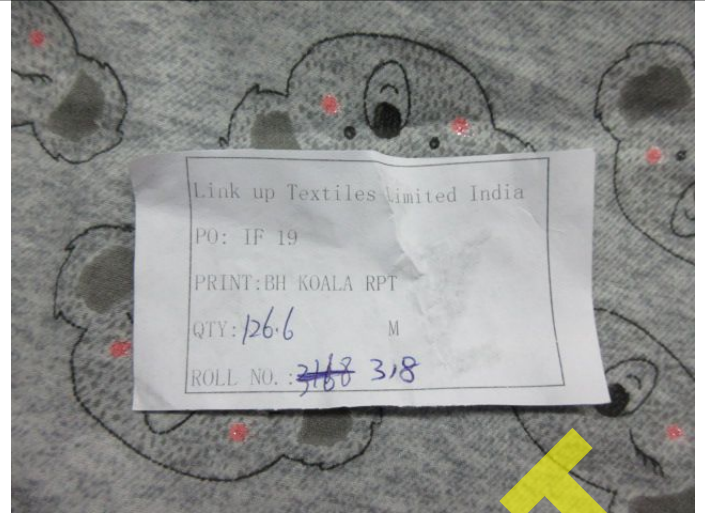

Package view



Return the Zero



The inspection process



Check width size




148 cm



126.96 m (label mark was 126.6 m)



Fabric textile

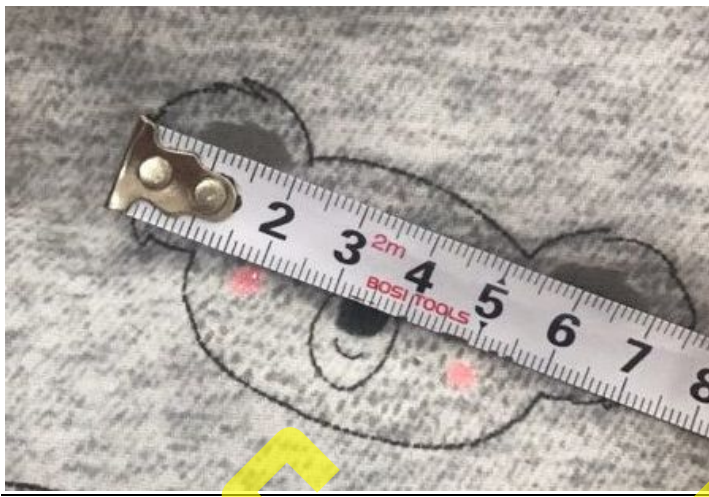

7.5 cm



3.5 cm




137 g



136 g



The color fastness test

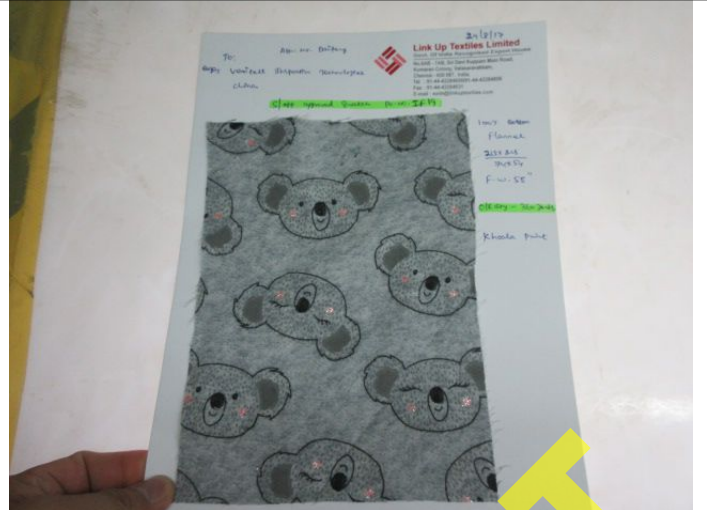

Sample



Comparison with sample




Comparison with sample


Conclusion:

Actual length was 126.9 m , label mark printed 126.6 m

64# roll

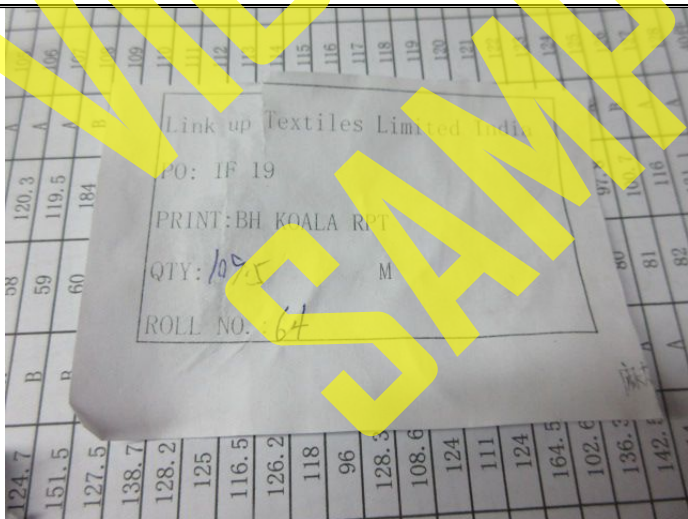

Label

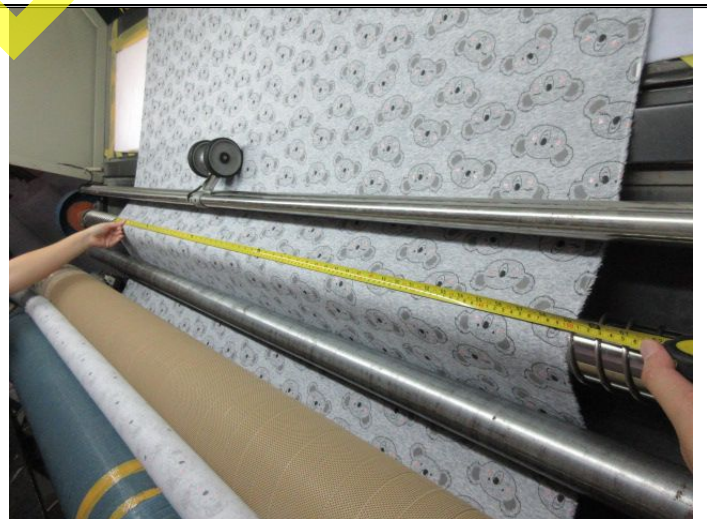

Check width size



150 cm



Length size 104.88 m



GSM 132 g



GSM 137 g



Disconnection

Conclusion:

Actual length was 109.5m , label mark printed 104.88 m. Besides, found disconnection more than 30 cm,


276# Roll



Label



Check width size

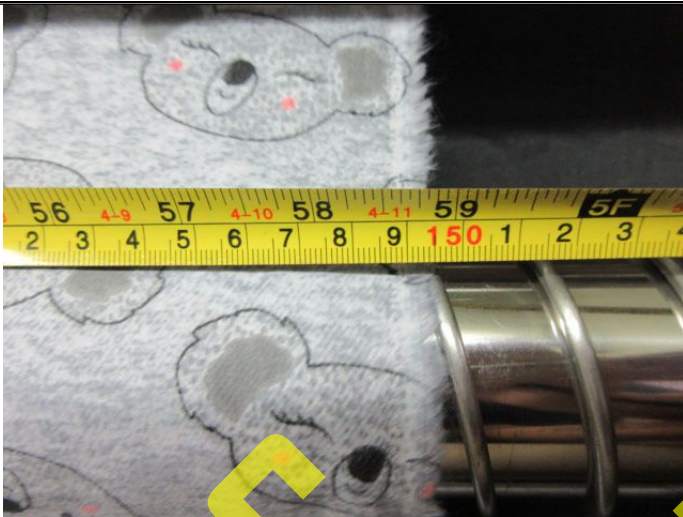

149.5 cm



Length size 129.27 m



GSM 136 g




GSM 139 g

Conclusion:

Actual length was 129m , label mark printed 129.27 m

150# Roll

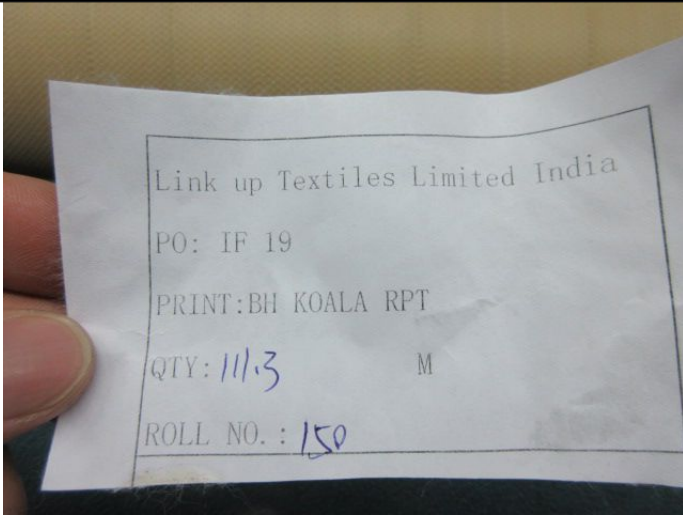

Label



Check length size



149 cm



Length size 110.81 m



GSM 133 g



GSM 141 g




Drape mark

Conclusion:

Actual length was 111.3m , label mark printed 110.81 m , found drape mark 1pcs

146# Roll

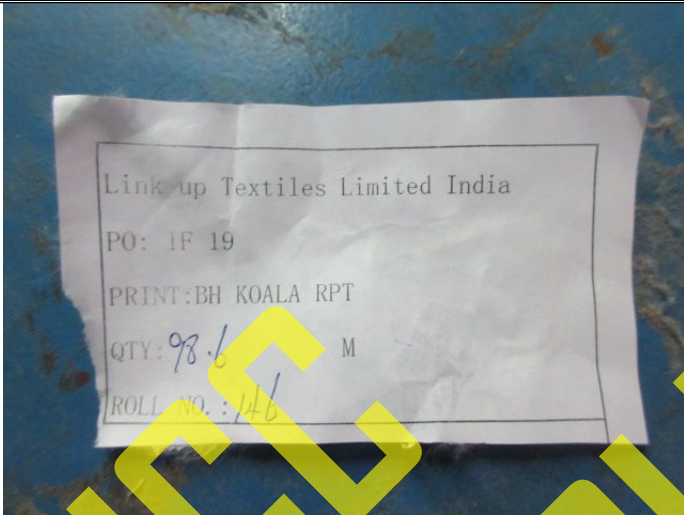

Label



Check width size



150.5 cm



Length size 97.36 g



GSM 131 g




GSM 132 g


Conclusion:

Actual length was 98.6 m , label mark printed 97.36 m

212# Roll

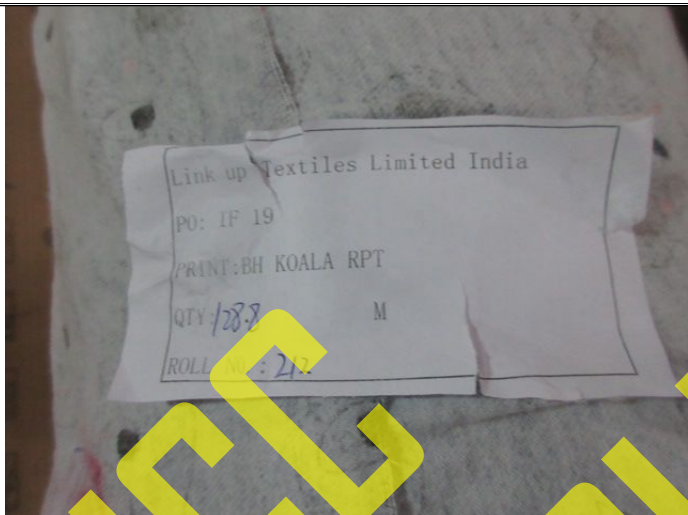

Label

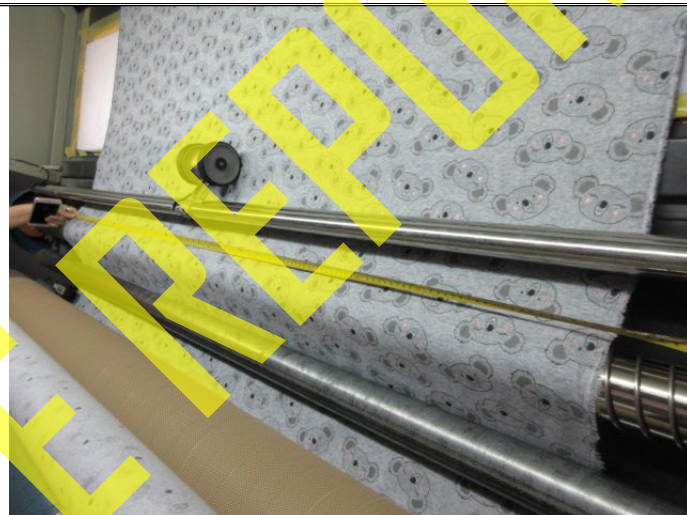

Check width size




150.5 cm



Check length size 104.88 m



GSM 136 g

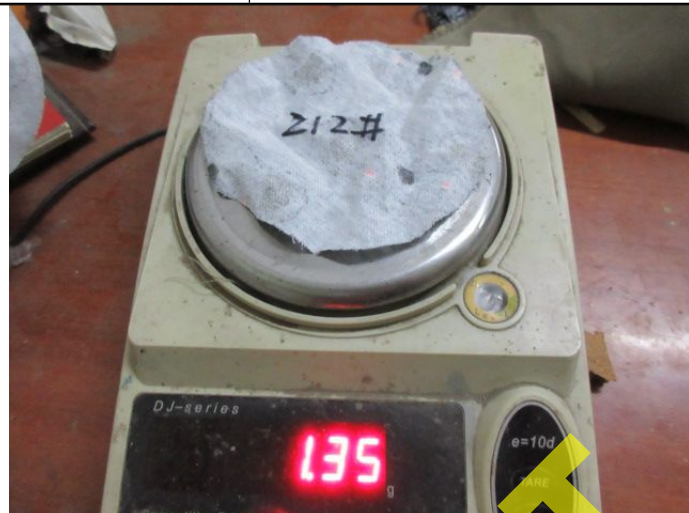

GSM 135 g



Hole

Conclusion:

Actual length was 128.8 m , label mark printed 129.67 m ,found 2cm hole 1pcs

The inspection report reflects our findings at the time and place of inspection. This report does not relieve the seller/manufacturer of their contractual liabilities or prejudice from the buyer's right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter

*******End of the Report*******